

SLICKLINE ASSISTANT WORKBOOK

IMPORTANT NOTE:

1. Your point of reference to complete this workbook may be obtained from the following
 - Training Manual and any other training materials provided together with this workbook
 - Your Trainer, Assessor (Slickline Operator), Verifier (FSM) or senior colleagues
 - SOP / Quality Procedures & Processors
2. The completion of this Workbook is a joint effort and responsibility between you and your assessor therefore you have the obligation to request from your assessor to be assessed upon your completion of each topic
3. The completion of this Workbook is part of the MANDATORY requirements which you must fulfill to qualify for a promotion
4. Your training program is mostly self-driven, including this Workbook. It requires individual initiatives, dedication and commitment to complete the process.

NAME	Mohammad Farhan bin Saifudin
DATE OF JOIN	11/12/23
CONTACT NO.	0197727475
RECEIVED DATE	8/1/24
DATE COMPLETED	15/3/24

D. Rig up Wireline Surface Equipment

a. List out all surface equipment (Surface and Pressure Gauge)

1. Generator Set
2. Air compressor
3. Powerpack
4. Reel Skid Unit (RSU)
5. Stuffing Box
6. Wireline Mast
7. Lubricator
8. Crossover
9. Blow Out Preventor (BOP)
10. Quick Test Sub (QTS)
11. Ball Valve
12. Single Well Control Panel (SWCP)
13. Hay Pulley

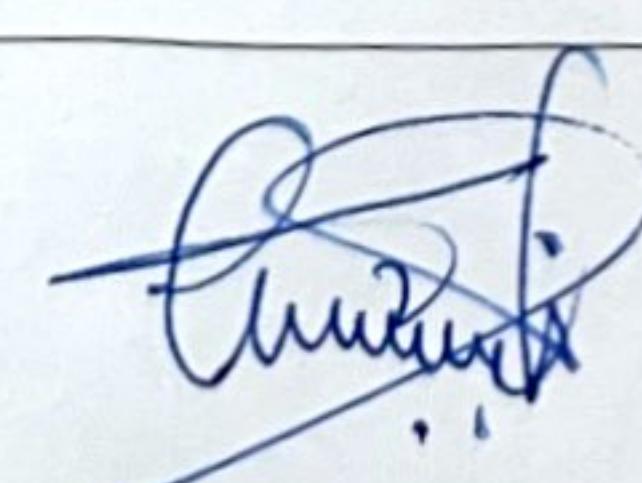
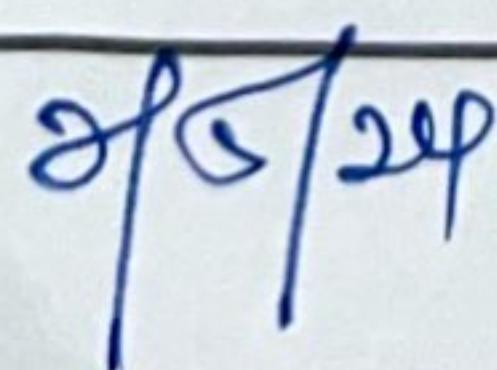
b. Describe how to connect lubricator section

i) Horizontal

Lay down lubricator on dolly trolley and connect three 8ft lubricator with stuffing box on the top. Apply lifting clamp on the top section of lubricator. Assemble the required number of sections for use above and below the BOP depending on the wireline work to be performed, such that the section with the smallest internal diameter (if any) will be the top most section and the section with the largest internal diameter at the bottom of the lubricator assembly. Make up all the quick unions hand tight.

GAZALI MEHRY
Operation Manager
Dimension Bid (M) Sdn Bhd
Labuan Warehouse
Slickline Services

Document No: SLS-FORM-150
Revision No.: 00
Effective Date: 01/04/19

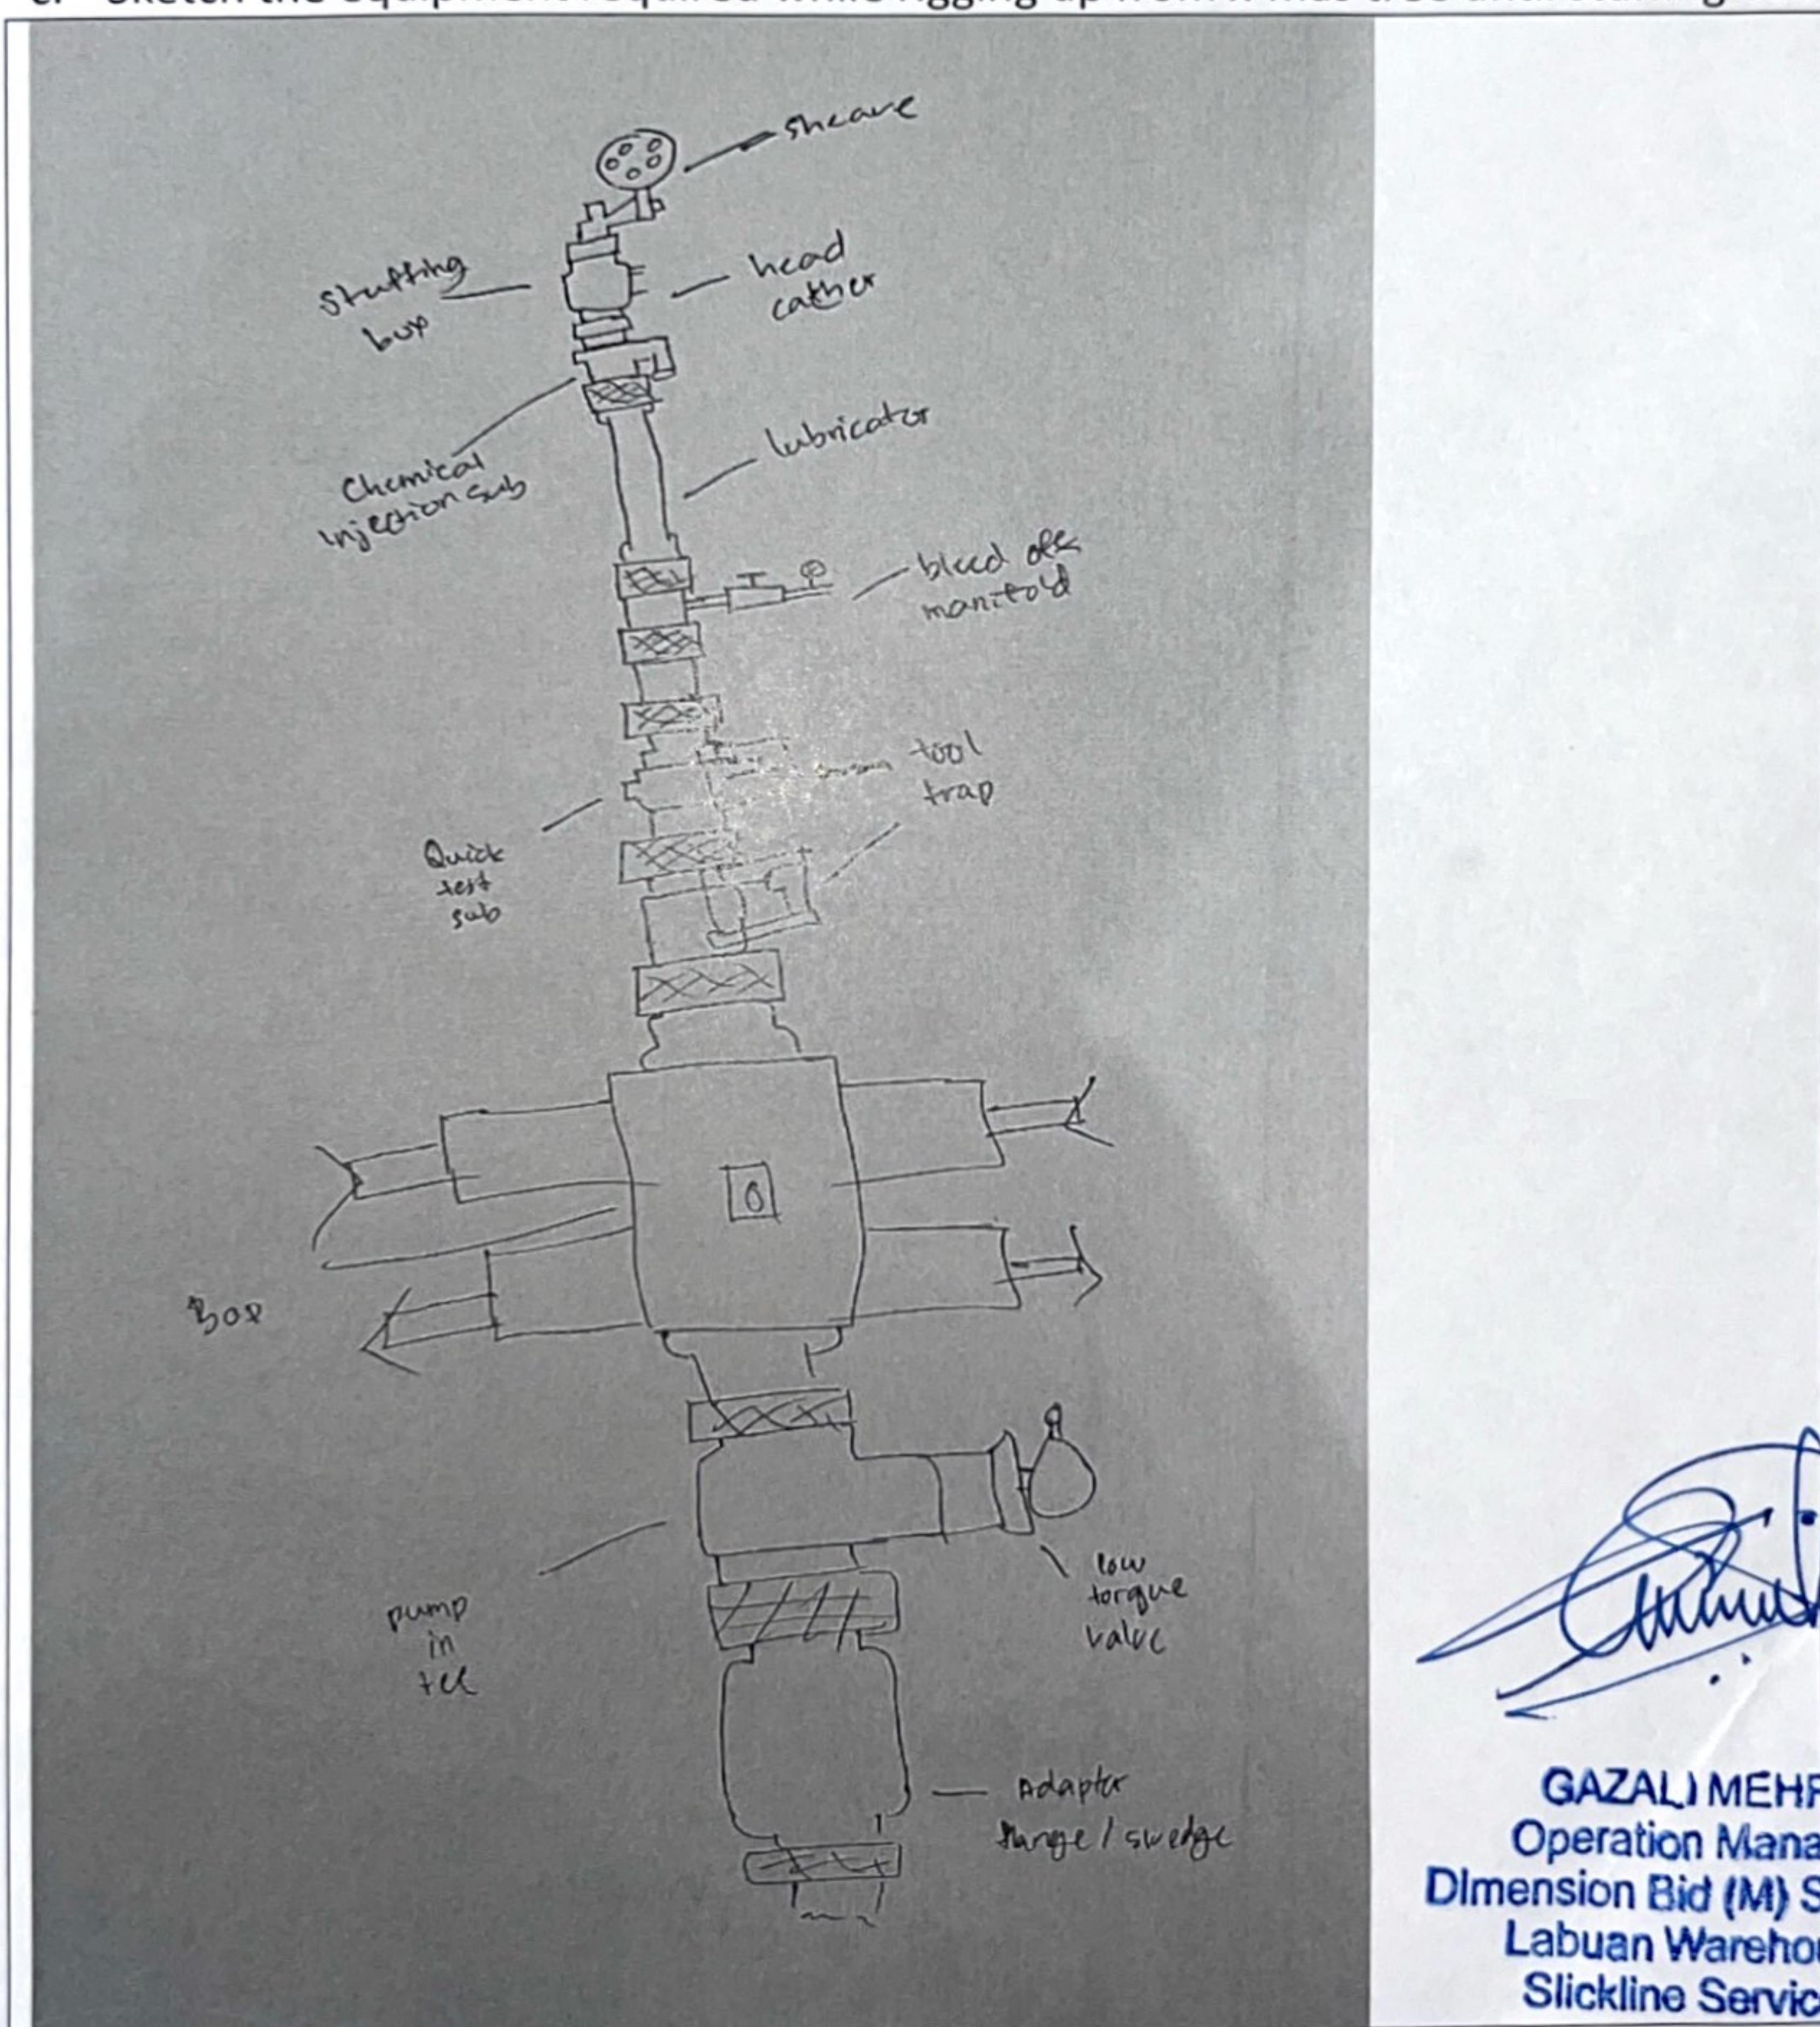
CONTROLLED COPY

ii) Vertical

Install the lubricator riser or adaptor to the tree cap connection, whichever is applicable. The wireline assistant on the wireline deck shall tie the chain block onto the other end of the length of rope held by the assistant on the gin pole. Secure lifting hook of the chain block to the lubricator lifting clamp. Hoist the lubricator by pulling the chain on the chain block until the lubricator is picked up to the required height for stabbing onto the Xmas tree or adaptor.

Note: Provide drawing and parts description on separate paper/page

c. Sketch the equipment required while rigging up from x-mas tree until stuffing box



Note: Provide drawing and parts description on separate paper/page

d. What should weight indicator attached with?

Load cell and hay pulley.

e. What is the meaning of rigging up and rigging down?

Rig up: prepare all equipment for operation.

Rig down: disassemble equipment ready for de-mob.

f. What is power pack hose size used at Dimension Bid?

1" for supply and 1 1/2 " for return.

g. What are the safety precautions required upon completed hook up hydraulic hose to RSU

Ensure that all hose are connected properly and lock ring is lock in place. Then make sure no leaking.

h. List out the safety precaution while rigging up and rigging down

Barricade working area and ensure that working area is in safe from other workers.

Making sure all surface equipment are as per client safety requirement.

GAZALI MEHRY
Operation Manager
Dimension Bid (M) Sdn Bhd
Labuan Warehouse
Slickline Services

Note: Provide drawing and parts description on separate paper